



INSSTALLATION AND

OPERATION

MANUAL

**SUBMERSIBLE MOTORS
TW4", GG4" & GF6"**

ENCAPSULATED SUBMERSIBLE MOTORS

INDEX

1.	OVERVIEW	4
2.	SAFETY	4
3.	APPLICATIONS	4
4.	LIQUIDS IN WHICH THE MOTOR CAN OPERATE	5
5.	COMPATIBLE PUMPS	5
6.	MOTOR POWERED BY A FREQUENCY CONVERTER	5
7.	INSTALLATION	6
8.	ELECTRICAL CONNECTIONS TO THE ELECTRIC PUMP	7
9.	MAINTENANCE, SERVICE	7
10.	SPARE PARTS	8
11.	STORAGE	8
12.	FREQUENCY OF STARTS	8
13.	MOUNTING POSITION	9
14.	WATER TEMPERATURE AND FLOW	10
15.	FLOW INDUCER SLEEVE	10
16.	HOT WATER APPLICATION	11
17.	CONTROL BOX MOUNTING	11
18.	SM04 2 WIRE MOTOR DIMENSIONS	12
19.	SM04 3 WIRE MOTOR DIMENSIONS	13
20.	SM06 MOTOR DIMENSIONS	14
21.	SINGLE PHASE - MOTOR DATA	15
22.	THREE PHASE - MOTOR DATA	16
23.	MOTOR WINDING RESISTANCE	17
24.	MAXIMUM CABLE LENGTHS IN FT	20
25.	TIGHTENING MOTOR LEAD CONNECTOR SCREWS	21
26.	SHAFT HEIGHT	21
27.	CONTROL BOX SMALL DIMENSIONS TYPE CSIR	21
28.	CONTROL BOX LARGE DIMENSIONS TYPE CSCR	22
29.	CONTROL BOX - WIRING DIAGRAMS – CSIR SERIES	23
30.	CONTROL BOX - WIRING DIAGRAMS – CSCR SERIES	26
31.	THREE PHASE POWER UNBALANCE	29
32.	TRANSFORMER SIZES	30
33.	POWER SUPPLY BY GENERATOR	31
34.	INSULATION TESTING	32
35.	RESISTANCE OF THE DROP CABLE	32
36.	TORQUE SETTINGS	33
37.	MOTOR WARRANTY FORM	34

INDEX OF TABLES

Table 1:	Power supply voltage tolerances	7
Table 2:	Maximum # starts per day	8
Table 3:	Minimum GPM required for motor cooling in water up to 95°F (35°C)	10
Table 4:	Minimum GPM required for motor cooling in water above 95°F (35°C)	11
Table 5:	TW4" 2W motors	12
Table 6:	GG4" 3W motors	13
Table 7:	GF6" 3W motors	14
Table 8:	TW4" 2 Wire – Single Phase - Motor Data	15
Table 9:	GG4" 3 Wire – Single Phase - Motor Data	15
Table 10:	GF6" Single Phase - Motor Data	15
Table 11:	GG4" Three Phase - Motor Data	16
Table 12:	GF6" Three Phase - Motor Data	19
Table 13:	TW4" Single Phase 2 Wire motor winding resistance	17
Table 14:	GG4" Single Phase 3 Wire motor winding resistance	17
Table 15:	GF6" Single Phase motor winding resistance	17
Table 16:	GG4" Three Phase motor winding resistance	18
Table 17:	GF6" Three Phase motor winding resistance	19
Table 18:	Cable sizing	20
Table 19:	Motor Shaft heights	21
Table 20:	Transformer sizing	31
Table 21:	Generator sizing	31
Table 22:	Drop cable resistance	32
Table 23:	Torque settings	33

1. OVERVIEW

Please read this documentation carefully before installation.

This manual gives important information concerning the installation, use and maintenance of the motors.

The contents of this manual refer to the standard product, as presented in the sales documentation.

The installation and operation must comply with the safety regulations in the country in which the product is installed.

The entire operation must be carried out in a workmanlike manner.

Failure to comply with the safety regulations not only causes risk to personal safety, it can also damage the equipment and it will invalidate every right to assistance under guarantee.

2. SAFETY

Below are the warning symbols used in this manual to warn of particular dangers



ELECTRIC SHOCK DANGER

The non observance of the prescription involves electric shock risk.



DANGER

The non observance of the prescription involves the risk of damages to persons and / or equipment.



MECHANICAL DANGER

The non observance of the prescription involves the risk of technical damages to the motor and / or installation.

3. APPLICATIONS



All the motors in the GG4, TW4 & GF6 ranges can be used to drive submersible pumps in the conditions established in CSA Standard C22.2 No. 100-14 (Motors and Generators) UL Standard 1004-1 (Electric Motors), and at the supply voltage / frequency specified on the rating plate.

The shaft extension and flange size of these motors comply with NEMA MG1:2016.

The power of the pumps coupled to these motors must be less than or equal to that of the motors.

4. LIQUIDS IN WHICH THE MOTOR CAN OPERATE

This motor can be used in cold water.



Do not use this motor with corrosive or explosive liquids



Do not use this motor with particularly dirty or hard water (impurities may deposit on the outer casing).

5. COMPATIBLE PUMPS

Make sure the motor is compatible with the pump. Incompatible combinations may cause problems. In particular, before coupling the motor to the pump check that:

- The power of the motor is greater than or equal to the power absorbed by the pump end.
- The rpm of the pump matches the rotational frequency of the motor.
- The pump has a NEMA motor connection and that the shaft turns freely.

6. MOTOR POWERED BY A FREQUENCY CONVERTER

Variable Frequency Drive's VFD's are used to change the rotational speed of the motor so that the out-put of the attached pump adjusts to the users demand for water.

VFD's also reduce the starting current and "water hammer" during starting.

TESLA's three-phase, encapsulated submersible motors can be used with variable frequency drives (VFD) when used within the guidelines listed here.

All three-phase, encapsulated submersible motors must have the VFD sized based on the motor's nameplate maximum amps, NOT horsepower. The continuous rated amps of the VFD must be equal to or greater than the motor's nameplate maximum amps or warranty will be void.

The VFD must have one RLC output filter to limit the voltage peaks and/or to reduce the dV/dt of the pulses generated by the inverter. The application of the filter will help to reduce the stress on the motor insulation (thermal and electrical). The filter can be installed at the inverter output to reduce the dV/dt value or at the motor terminals to attenuate the voltage peaks amplitude.

The motor must reach or pass the 30 Hz operating speed within 1 second of the motor being energized. If this does not occur, the motor bearings will be damaged and the motor life reduced.

6. VFD continued.

TESLA suggests these MAX values for three phase encapsulated submersible motors

Max. Vpeak voltage: 1000 V phase-phase

Max. dV/dt :2000 V/μs

Filters are usually applied when the power cable to the motor is longer than 50ft (15.2m)

Tesla suggests the use of an input filter when the VFD is used in a residential area, to protect other devices connected to the same mains from noise caused by the VFD

Frequency range: 30 Hz – 60 Hz

Drive carrier frequency: The range must be from 4.5k to 5k Hz .

Higher values will increase the quantity of Voltage Spikes x per second and reduce motor insulation lifetime.

Lower values give a poor shape to the power curve.

Ramp-up time / Ramp down time: $|df/dt| > 30 \text{ Hz/sec}$ (where f indicates the frequency) to ensure the life of the thrust bearings

The motor's operating speed must always operate so the minimum cooling flows are reached.

0.98 ft/sec for 6-inch motors

0.98 ft/sec for 4-inch motors

Motor overload protection must trip within a time equal to or faster than how indicated by Class 10 overload curve and must trip within 115% of the nameplate Max. Amp.

In the GF 6" motor it is possible to monitor the temperature of the motor with a Pt100 or PTC sensor (6" motor only).

TESLA's encapsulated submersible motors are not declared inverter duty motors by NEMA MG1 standards. The reason is NEMA MG1 standard part 31 does not include a section covering encapsulated winding designs.

TESLA's submersible motors can be used with VFDs without problems or warranty concerns providing all TESLA's guidelines are followed.

TESLA's single-phase, 2- and 3-wire, encapsulated submersible motors should only be used with the appropriate variable speed drive.

7. INSTALLATION



Before installing the motor, read both the motor and pump instructions manuals.

Keep both manuals in a safe place.

If the product shows any signs of damage, do not proceed with installation and call your local stockist / distributor.

You must use suitable equipment and protective devices. Observe all accident prevention regulations.

Installations must always be in accordance with current local and/or national regulations, legislation and bylaws governing installation of water and power equipment.

TESLA submersible motors are designed to be used in a shaft up vertical position.

During acceleration, the pump thrust increases as its output head increases. In cases where the pump head stays below its normal operating range during startup and full speed condition, the pump may create upward thrust. This creates upward thrust on the motor upthrust bearing. This is an acceptable operation for short periods at each start, but running continuously with upthrust will cause excessive wear on the upthrust bearing.

8. ELECTRICAL CONNECTIONS TO THE ELECTRIC PUMP



Electrical connections may only be performed by a qualified installer in compliance with current regulations.

Make sure that the supply voltage and frequency are compatible with the electrical panel.

The relative information is shown on the motor rating plate and in the documents supplied with the panel.

Provide suitable short circuit protection on the supply line.

Before proceeding, make sure that all the connections (even if they are potential-free) are voltage-free.

Unless otherwise specified in local bylaws, the supply line must be fitted with:

- a short circuit protection device,
- a high sensitivity ground-fault circuit interrupter (GFCI) residual current circuit breaker (30mA) for additional protection from electrocution in case of inefficient grounding,
- a general switch with a contact aperture of at least 3 millimetres.

Ground the system in compliance with current regulations

Table 1: Power supply voltage tolerances

Power supply voltage tolerances:-			
Frequency in Hz	Phase ~	Voltage	Tolerance %
60	1	115v	-10% +6 %
60	1	230v	-10% +6 %
60	3	460v	-10% +6 %
60	3	575v	-10% +6 %

Single-phase version



Connect the electric pump to a supply line via a suitable electrical control panel containing the overload protection and the capacitor.

Refer to the wiring diagram on the outer casing of the motor and in figure 1 and the documentation supplied with the electrical panel.

Refer to the motor rating plate for the capacity of the capacitor.

Install the electrical panel in a sheltered area.

Three-phase version **Class 10 Protection required**



The characteristics of submersible motors are different than standard motors and special overload protection is required.

If the motor is locked, the overload protection must trip within 10 seconds to protect the motor windings.

Connect the electric pump to a supply line via a suitable electrical control panel with a Class 10 overload.

Install the electrical panel in a sheltered area.

For connections to any external control devices (e.g.: pressure switch, float) follow the instructions supplied with these devices

9. MAINTENANCE, SERVICE



Before proceeding, always make sure the motor is disconnected from the supply line.

Maintenance operations may only be performed by expert and qualified people.

Use suitable equipment and protective devices. Observe all accident prevention regulations.

Do not attempt to disconnect the connector from the motor head cable.

This may only be done by authorised personnel.

The motor does not require any scheduled routine maintenance.

Users wishing to prepare a maintenance schedule should bear in mind that maintenance frequencies depend on the conditions of use.

For any requirements, please contact our Sales and Service Department.

10. SPARE PARTS



Only use original spare parts to replace faulty components.

Always specify the exact type of motor and code when requesting our Sales and Assistance Service for technical information or spare parts.

Only use original spare parts to replace faulty components. Unsuitable spare parts may cause the product to work incorrectly and cause hazards for people and property.

11. STORAGE

TESLA submersible motors are a water-lubricated design.

The fill solution consists of a mixture of deionized water and Propylene Glycol (a non-toxic antifreeze).

The solution will prevent damage from freezing in temperatures to -23°F (-5°C); motors should be stored in areas that do not go below this temperature.

There may be an interchange of fill solution with well water during operation. Care must be taken with motors removed from wells during freezing conditions to prevent damage.

When the storage temperature does not exceed 104°F (40°C), storage time should be limited to two years. Where temperatures reach 100° to 130°F, storage time should be limited to one year.

Loss of a few drops of liquid will not damage the motor as an excess amount is provided, and the filter check valve will allow lost liquid to be replaced by filtered well water upon installation. If there is reason to believe there has been a considerable amount of leakage, consult the factory for checking procedures.

TESLA recommend that you leave the motor in its original packaging until the day of installation.

When standing the motor upright make sure that it cannot fall over (shaft always upwards).

Do not subject the motor to direct sunlight or other heat sources.

If the **GF6** motor is older than one year (in case of reuse or after long storage) the motor fluid level must be checked before installation.

12. FREQUENCY OF STARTS

The average number of starts per day over a period of months or years influences the life of a submersible pumping system.

Excessive cycling affects the life of control components such as pressure switches, starters, relays and capacitors. Rapid cycling can also cause motor spline damage, bearing damage, and motor overheating.

All these conditions can lead to reduced motor life.

The pump size, tank size and other controls should be selected to keep the starts per day as low as practical for longest life.



4 Inch motors should run a minimum of two minutes in order to dissipate heat built up from starting.

6 Inch motors should run a minimum of three minutes in order to dissipate heat built up from starting.

GF6 motors should have a minimum of 10 minutes between starts or starting attempts.

Table2: Maximum # starts per day

Motor Rating		Maximum # starts per day	
HP	KW	SINGLE-PHASE	THREE-PHASE
0.5 - 1.0	0.37 - 0.75	300	300
1.5 - 5.0	1.1 - 3.7	100	300
7.5 - 15	5.5 - 11	50	200
20 - 30	15 - 22	-	200
40 and above	30 and above	-	100

13. MOUNTING POSITION

TESLA submersible motors are designed primarily for operation in the vertical, shaft-up position.


During acceleration, the pump thrust increases as its output head increases. In cases where the pump head stays below its normal operating range during startup and full speed condition, the pump may create upward thrust. This creates upward thrust on the motor upthrust bearing. This is an acceptable operation for short periods at each start, but running continuously with upthrust may cause excessive wear on the upthrust bearing



With certain restrictions, motors are also suitable for operations in positions from shaft-up to shaft-horizontal. As the mounting position becomes further from vertical and closer to horizontal, the probability of shortened thrust bearing life increases. For normal thrust bearing life expectancy with motor positions other than shaft-up, follow these recommendations:

1. All the motors in the range can be installed horizontally as long as the axial thrust of the pump never falls below 22.48lbs (100 N) while it is working.
2. Do not use in systems which can run even for short periods at full speed without thrust toward the motor
3. Minimize the frequency of starts, Six inch motors should have a minimum of 20 minutes between starts or starting attempts

For normal motor life expectancy in the in the GF6 submersible motors we advise to keep the shaft up a min of 30° from the horizontal

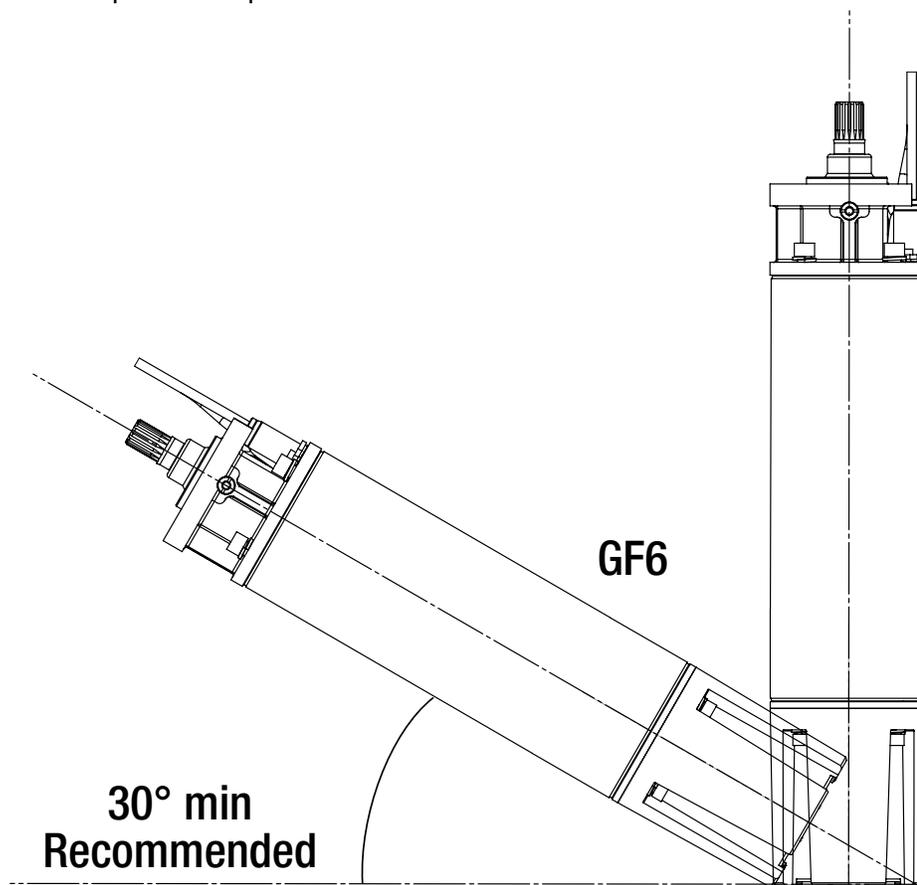

14. WATER TEMPERATURE AND FLOW

Tesla standard submersible motors are designed to operate up to maximum service factor horsepower in water up to 95°F (35°C).

A minimum flow of 0.98 ft/sec for 4" & 6" motors is required for proper cooling.

Table 3: Minimum GPM required for motor cooling in water up to 95°F (35°C)

Minimum GPM required for motor cooling in water up to 95°F (35°C)			
Casing or Sleeve I.D. Inches (mm)		4" Motor (1/2-10Hp)	
		0.98 ft/sec (0.3m/sec)	
		GPM (l/min)	
		6" Motor	
		0.98 ft/sec (0.3m/sec)	
		GPM (l/min)	
4"	102	6.5 (24.5)	
5"	127	28 (106)	
6"	152	55 (208)	18 (68)
7"	178	86 (325)	50 (190)
8"	203	122 (461)	90 (340)
10"	254	209 (791)	180 (680)
12"	305	315 (1192)	280 (1060)
14"	356	440 (1665)	400 (1520)
16"	406	585 (2214)	560 (2120)

The table shows minimum flow rates, in GPM, for various well diameters and motor sizes

15. FLOW INDUCER SLEEVE


If the flow rate is less than specified or coming from above the pump, then a flow inducer sleeve must be used. A flow sleeve is always required in an open body of water.

Figure shows a typical flow inducer sleeve construction.

Example : A four-inch motor and pump that delivers 60 GPM will be installed in a 8" well.

From Table 2

A 122 GPM flow would be required to maintain proper cooling in an 8" casing, as the 6" casing requires a min flow of 55gpm then adding an 6" or smaller flow sleeve provides the required cooling.

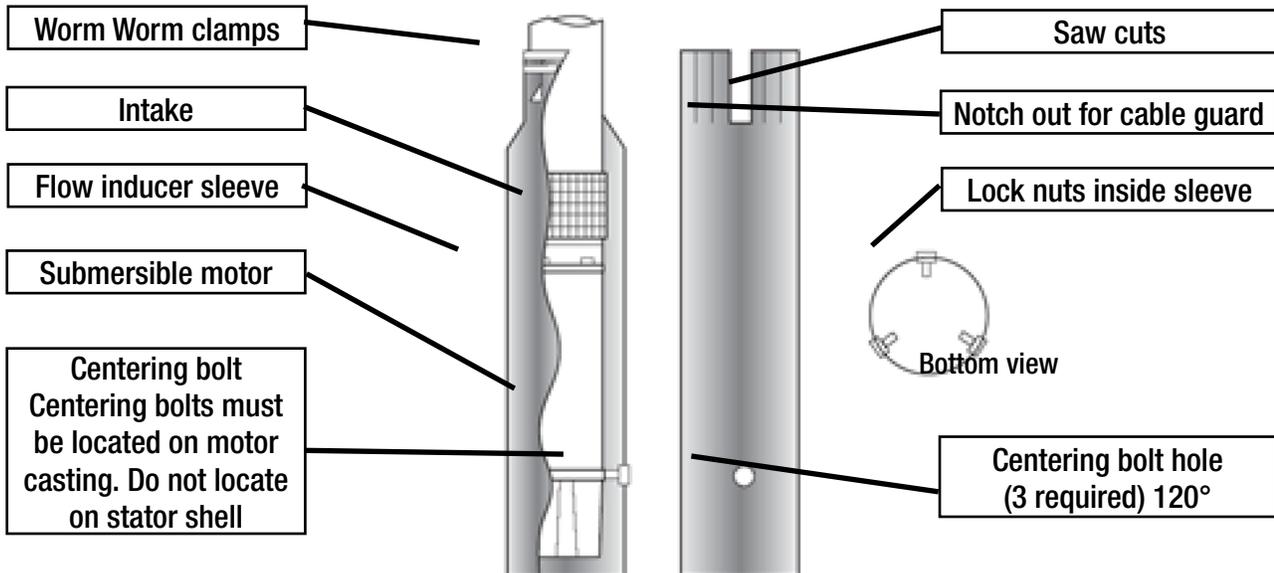

16. HOT WATER APPLICATION

When the pump-motor operates in water hotter than 95°F (35°C), a flow rate of at least 11.5 ft/sec is required. When selecting the motor to drive a pump in over 95°F (35°C) water, the motor horsepower must be de-rated per the following procedure.

Using next Table to determine pump GPM required for different well or sleeve diameters. If necessary, add a flow sleeve to obtain at least 11.5 ft/sec flow rate.

Table 4: Minimum GPM required for motor cooling in water above 95°F (35°C)

Minimum GPM required for motor cooling in water above 95°F (35°C)			
Casing or Sleeve I.D. Inches (mm)		4" Motor (1/2-10Hp)	6" Motor
		11.5 ft/sec (3.2m/sec)	11.5 ft/sec (3.2m/sec)
		GPM (l/min)	GPM (l/min)
4"	102	75 (283)	
5"	127	330 (1244)	
6"	152	650 (2450)	104 (394)
7"	178	86 (325)	300 (1136)
8"	203	122 (461)	1040 (3840)

The table shows minimum flow rates, in GPM, for various well diameters and motor sizes

17. CONTROL BOX MOUNTING

Single phase submersible control boxes feature NEMA 3R enclosures for indoor or outdoor mounting. They should be mounted in a vertical position as relay manufacturers recommend correct relay positioning for proper, trouble-free operation.

Control boxes should be shaded from direct sunlight in areas where temperatures exceed 95°F (35°C) as excessive heat may dry out capacitors and shorten their life. It is advisable to paint the enclosure white if outside in very hot, sunny climates.

18. TW4" 2 WIRE MOTOR DIMENSIONS

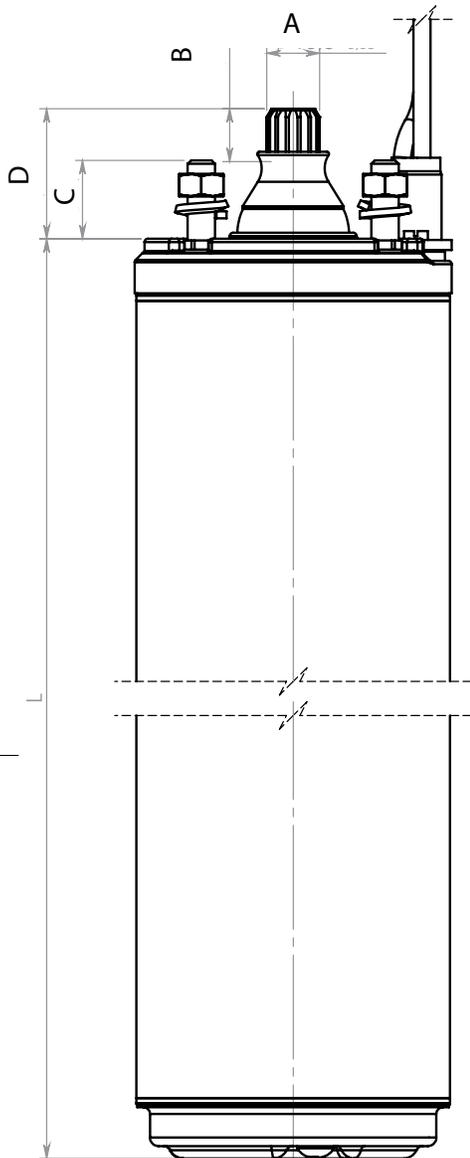



Table 5: TW4" 2 WIRE MOTORS

TW4" DIMENSIONS							
SINGLE PHASE MOTORS							
Type	P2		L		Weight		Axial thrust
	[hp]	[kW]	[mm]	[inch]	[Kg]	[lbs]	[lbf]
60 Hz	0.5/115v	0.37	341	13.425	9.7	21.4	500
	0.5/230v	0.37	331	13.031	9.5	21	500
	0.75	0.55	351	13.819	10.5	23.2	500
	1	0.75	426	16.772	13.1	28.9	700
	1.5	1.1	471	18.543	15.1	33.3	700

TW4" DIMENSIONS						
Pos.	mm	inch	Pos.	mm	inch	
A	$\varnothing 15.5^{+0.05}_{-0.03}$	$0.61^{+0.002}_{-0.003}$	E	$37.2^{+0.4}_{-0.4}$	$1.465^{+0.016}_{-0.016}$	
B	$15^{+0.5}_{-0}$	$0.591^{+0.02}_{-0}$	F	$\varnothing 76.2^{+0.01}_{-0}$	$3^{+0.004}_{-0}$	
C	$23^{+0.5}_{-0.5}$	$0.906^{+0.005}_{-0.005}$	G	$\varnothing 87.3^{+0}_{-0.1}$	$3.437^{+0}_{-0.004}$	
D	$38.17^{+0.13}_{-0.12}$	$1 \frac{1}{2}^{+0.02}_{-0.02}$				


12

5/16" 24 UNF


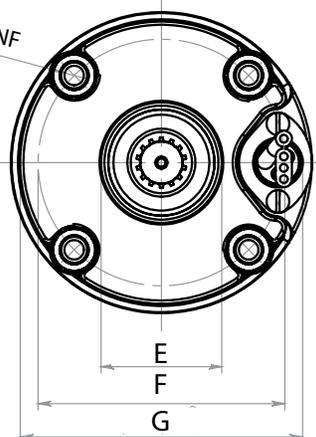


19. GG4" 3 WIRE MOTOR DIMENSIONS


Table 6: GG4" 3 WIRE MOTORS

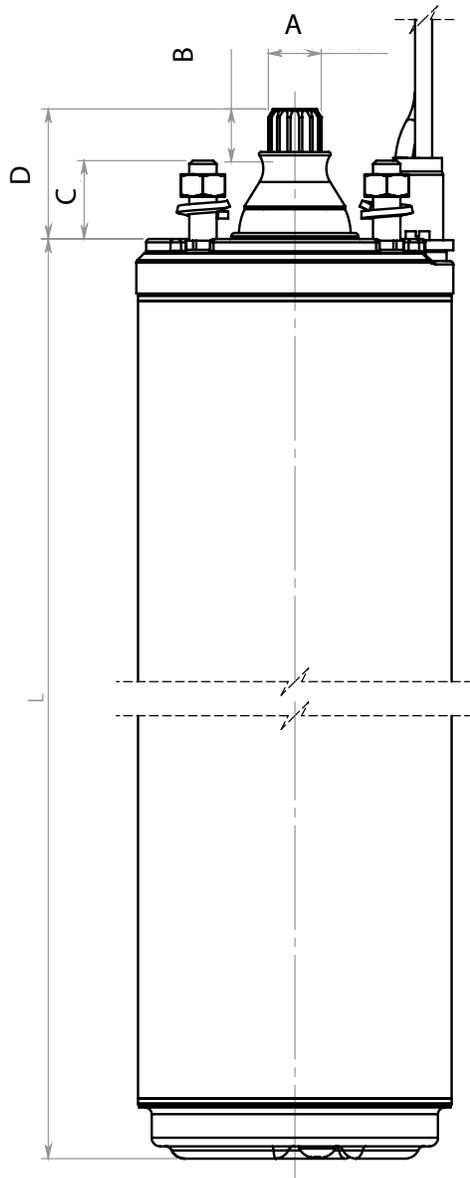

SM04 DIMENSIONS							
<i>SINGLE PHASE MOTORS</i>							
Type	P2		L		Weight		Axial thrust
	[hp]	[kW]	[mm]	[inch]	[Kg]	[lbs]	[lbf]
60 Hz 3W	0.5	0.37	266	10.472	8.8	19.4	500
	0.75	0.55	286	11.26	9.7	21.4	500
	1	0.75	346	13.622	12.6	27.8	700
	1.5	1.1	411	16.181	14.7	32.5	700
	2	1.5	411	16.181	14.8	32.7	700
	3	2.2	544	21.417	20.5	45.2	1500
5	3.7	684	26.929	27.1	59.8	1500	
<i>THREE PHASE MOTORS</i>							
Type	P2		L		Weight		Axial thrust
	[hp]	[kW]	[mm]	inch]	[Kg]	[lbs]	[lbf]
60 Hz	0.5	0.37	236	9.291	7.4	16.3	500
	0.75	0.55	266	10.472	8.8	19.4	500
	1	0.75	286	11.26	9.7	21.4	500
	1.5	1.1	346	13.622	11.7	25.8	700
	2	1.5	391	15.394	13.8	30.5	700
	3	2.2	504	19.843	18.5	40.8	1500
	5.5	4	614	24.173	23.5	51.9	1500
	7.5	5.5	684	26.929	27.1	59.8	1500
	10	7.5	764	30.079	31.1	68.7	1500
GG4" DIMENSIONS							
Pos.	mm	inch		Pos.	mm	inch	
A	$\emptyset 15.5^{+0.05}_{-0.03}$	0.610		E	$37.2^{+0.4}_{-0.4}$	1.465	
B	$15^{+0.5}_{-0}$	0.591		F	$\emptyset 76.2^{+0.01}_{-0}$	3"	
C	$23^{+0.5}_{-0}$	7/8"		G	$\emptyset 87.3^{+0}_{-0.1}$	3 3/8"	
D	$38.17^{+0.13}_{-0.12}$	1 1/2"					

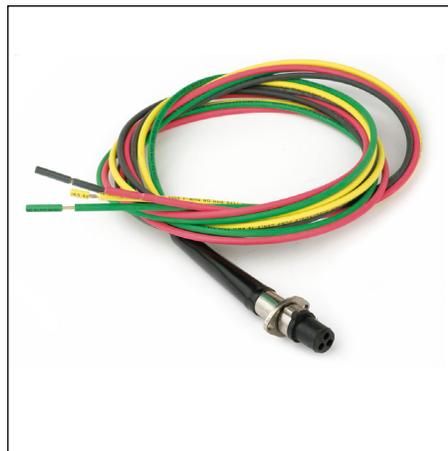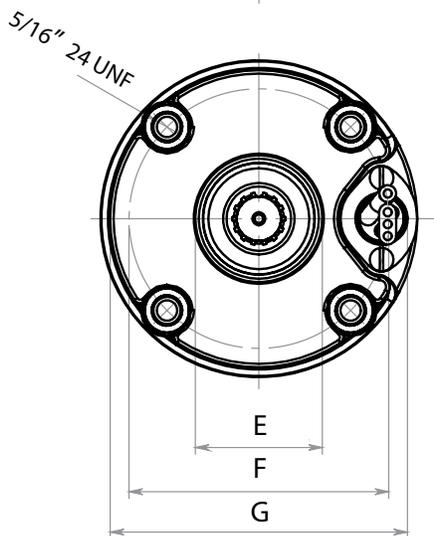


20. GF6" MOTOR DIMENSIONS

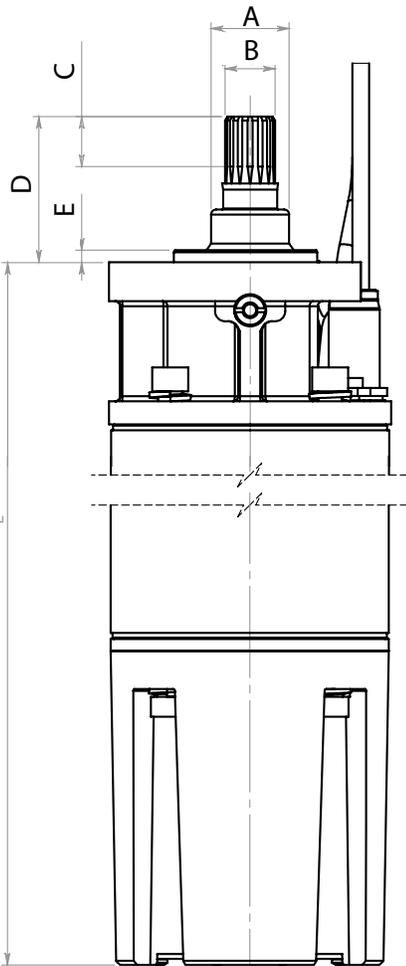

14

Table 7: GF6" 3 WIRE MOTORS

GF6" DIMENSIONS							
SINGLE PHASE MOTORS							
Type	P2		L [inch]		Weight		Axial thrust
	[hp]	[kW]	[mm]	[inch]	[Kg]	[lbs]	[lbf]
60Hz	7.5	5.5	730	28.74	70.1	154.5	3600
	10	7.5	786	30.944	76.2	168	3600
	15	11	861	33.897	84	185.2	3600
THREE PHASE MOTORS							
Type	P2		L		Weight		Axial thrust
	[hp]	[kW]	[mm]	[inch]	[Kg]	[lbs]	[lbf]
60 Hz	5.5	4	601	23.661	55.9	123.3	3600
	7.5	5.5	631	24.843	59.3	130.7	3600
	10	7.5	661	26.023	62.3	137.4	3600
	12.5	9.3	686	27.008	65.4	144.2	3600
	15	11	731	28.779	73.5	162.1	3600
	20	15	786	30.944	79.3	174.8	3600
	25	18.5	861	33.897	87.1	192.1	3600
	30	22	921	36.258	93.1	205.3	3600
	40	30	1051	41.377	107.3	236.6	6000
	50	37	1181	46.496	124.5	274.5	6000
60	45	1361	53.582	141.3	311.5	6000	

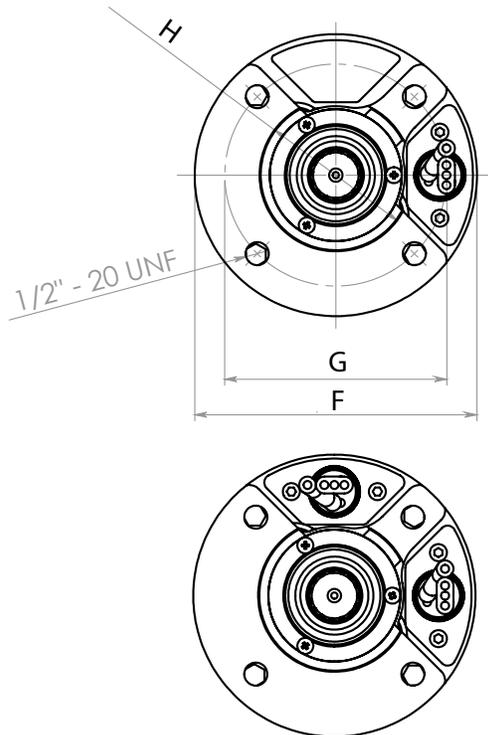

GF6" DIMENSIONS						
Pos.	mm	inch		Pos.	mm	inch
A	∅ 39	1.535		E	6 ⁺⁰ _{-0.2}	0.236
B	∅ 25 ^{+0.1} ₋₀	0.984		F	∅ 141	5.551
C	25 ^{+0.5} ₋₀	0.984		G	∅ 111 ^{+0.2} ₋₀	4.370
D	72.83 ^{+0.19} _{-0.18}	2.867		H	∅ 76.15 ⁺⁰ _{-0.04}	3.000

21. SINGLE PHASE - MOTOR DATA

Table 8: TW4" 2 WIRE MOTOR DATA

ELECTRICAL DATA TW4" 2W														
<i>SINGLE PHASE MOTORS</i>														
P2		V	SF	In	In (SF)	Is/In	Cs/Cn	P1	N	Cos φ	η	C	Ø	LC
[hp]	[kW]	[V]		[A]	[A]			[W]	[min ⁻¹]		%	[μF]	[AWG]	[ft]
0.5	0.37	115	1.6	8.6	10	4.2	0.65	800	3450	0.88	46	80	3x14	5½
		230	1.6	3.9	5	4.6	0.65	800	3450	0.88	46	20	3x14	5½
0.75	0.55	230	1.5	6.3	6.9	4.3	0.65	1200	3450	0.82	47	25	3x14	5½
1	0,75	230	1.4	7.7	8.8	4.8	0.68	1500	3450	0.84	50	35	3x14	5½
1.5	1.1	230	1.3	11.8	12.7	4.7	0.7	2120	3450	0.85	53	40	3x14	5½

Table 9: GG4" 3 WIRE MOTOR DATA

ELECTRICAL DATA SM04 3W															
<i>SINGLE PHASE MOTORS</i>															
P2		V	SF	In	In (SF)	Is/In	Cs/Cn	P1	N	Cos φ	η %	C1	C2	Ø	LC
[hp]	[kW]	[V]		[A]	[A]			[W]	[min ⁻¹]	100% Load	100% Load	[μF]	[μF]	[AWG]	[ft]
0.5	0.37	115	1.6	10.0	12.6	4.0	3.2	800	3450	0.71	48	-	250-300	4x14	5½
		230	1.6	5.5	6.8	4.2	3.9	800	3450	0.62	46	-	59-71	4x14	5½
0.75	0.55	230	1.5	7.4	8.6	4.6	3.6	1100	3450	0.65	53	-	86-103	4x14	5½
1	0.75	230	1.4	8.0	9.8	5.5	2.9	1350	3450	0.68	58	-	105-126	4x14	5½
1.5	1.1	230	1.3	10.0	12.0	6.0	1.9	1800	3450	0.81	64	10	105-126	4x14	5½
2	1.5	230	1.25	10.5	12.3	5.3	2.3	2200	3450	0.95	69	20	105-126	4x14	5½
3	2.2	230	1.15	14.3	16.2	5.5	2.1	3100	3450	0.97	72	45	208-250	4x14	5½
5	3.7	230	1.15	22.2	25.5	5.5	1.8	5000	3450	0.99	74	2x40	270-324	4x14	8 ¾

15

Table 10: GF6" SINGLE PHASE MOTOR DATA

ELECTRICAL DATA GF6" 3W														
<i>SINGLE PHASE MOTORS</i>														
P2		V	SF	In	In (SF)	Cn	P1	N	Cos φ	η %	C		Ø	LC
[hp]	[kW]	[V]		[A]	[A]		[W]	[min ⁻¹]	100% Load	100% Load	Start	Run	[AWG]	[ft]
7.5	5.5	230	1.15	33	37	15	7520	3490	0.72	74	486-584	45	4x10	13
10	7.5	230	1.15	43	49	20	9800	3490	0.76	77	616-740	70	4x10	13
15	11	230	1.15	63	74	30	14350	3490	0.77	76	701-841	135	4x8	13

P2: ++Rated output
 V: Rated voltage
 SF: Service factor
 In: Rated current
 In (SF): Service factor current
 Is/In: Locked rotor current/Rated current
 Cs/Cn: Locked rotor Torque/Rated Torque
 P1: Power consumption
 N: R.P.M Revolutions Per Minute

Cos φ: Power factor at 100% Load
 η: Efficiency at 100% Load
 C: Capacitor
 Ø: Cable section
 LC: Cable length

22. THREE PHASE - MOTOR DATA

Table 11: GG4" 3 PHASE MOTOR DATA

ELECTRICAL DATA GG4"														
<i>THREE PHASE MOTORS</i>														
P2		V	SF	In	In (SF)	Is/In	Cs/Cn	P1	N	Cos φ	η %	C	Ø	LC
[hp]	[kW]	[V]		[A]	[A]			[W]	[min ⁻¹]	100% Load	100% Load	[μF]	[mm ²]	[ft]
0.5	0.37	230	1.6	3.6	3.7	4.4	3.4	690	3450	0.48	54	4x14	5½	5½
		460	1.6	1.6	1.9	5.0	3.2	650	3450	0.54	57	4x14	5½	5½
0.75	0.55	230	1.5	4.6	4.9	5.2	3.7	860	3450	0.47	63	4x14	5½	5½
		460	1.5	2.2	2.4	5.5	3.6	840	3450	0.48	65	4x14	5½	5½
1	0.75	230	1.4	4.7	5.2	6.4	4.3	1200	3450	0.63	63	4x14	5½	5½
		460	1.4	2.6	2.8	5.8	4.2	1200	3450	0.59	63	4x14	5½	5½
1.5	1.1	230	1.3	8.1	8.5	5.9	4.2	1800	3450	0.54	61	4x14	5½	5½
		460	1.3	3.6	3.9	6.7	4.1	1720	3450	0.60	64	4x14	5½	5½
2	1.5	230	1.25	10.2	10.8	6.1	3.9	2290	3450	0.54	65	4x14	5½	5½
		460	1.25	4.6	4.9	6.7	3.8	2160	3450	0.59	69	4x14	5½	5½
3	2.2	230	1.15	10.7	11.6	7.5	4.8	3100	3450	0.69	71	4x14	5½	5½
		460	1.15	5.6	6.0	7.1	4.8	3050	3450	0.68	72	4x14	5½	5½
5.5	4	230	1.15	16.7	17.3	7.9	3.7	4300	3450	0.65	70	4x14	8¾	8¾
		460	1.15	7.2	7.6	7.4	4.0	5300	3450	0.75	75	4x14	8¾	8¾
7.5	5.5	230	1.15	25.7	27.5	7.0	3.9	7260	3450	0.71	76	4x14	8¾	8¾
		460	1.15	12.0	13.0	7.5	3.8	7050	3450	0.74	79	4x14	8¾	8¾
10	7.5	460	1.15	15.4	16.9	7.1	3.9	9100	3450	0.74	82	4x14	11½	11½

Table 12: GF6" 3 PHASE MOTOR DATA

ELECTRICAL DATA GF6"														
<i>THREE PHASE MOTORS</i>														
P2		V	SF	In	In (SF)	Is/In	P1	N	Cos φ	η %	Start*	Ø	LC	
[hp]	[kW]	[V]		[A]	[A]		[W]	[min ⁻¹]	100% Load	100% Load		[AWG]	[ft]	
5,5	4	230	1.15	18.5	20	5.1	5700	3450	0.77	70		4x10	13	
		460	1.15	8.6	9.5	5.5	5700	3470	0.83	70	Y	4x10	13	
		575	1.15	6.9	7.6	5.5	5700	3470	0.83	70	Y	4x10	13	
7,5	5,5	230	1.15	24	26.6	5	7400	3480	0.77	74		4x10	13	
		460	1.15	12	13.3	5	7400	3480	0.77	74	Y	4x10	13	
		575	1.15	9.6	10.6	5	7400	3470	0.77	74	Y	4x10	13	
10	7,5	230	1.15	34	37	4.8	9900	3465	0.73	76		4x10	13	
		460	1.15	15	16.5	5.5	9900	3465	0.83	76	Y	4x10	13	
		575	1.15	12	13.2	5.5	9900	3465	0.83	76	Y	4x10	13	
12,5	9,3	230	1.15	37.4	41.2	4.8	11650	3490	0.78	80		4x10	13	
		460	1.15	18.7	20.6	4.8	11650	3490	0.78	80	Y	4x10	13	
		575	1.15	15	16.5	4.8	11650	3470	0.78	80	Y	4x10	13	
15	11	230	1.15	50	54	4.4	13400	3495	0.67	82		4x10	13	
		460	1.15	21	23.3	5.2	13400	3495	0.8	82	Y	4x10	13	
		575	1.15	16.8	18.6	5.2	13400	3480	0.8	82	Y	4x10	13	
20	15	230	1.15	63	68	4.8	18200	3475	0.73	82		4x10	13	
		460	1.15	27.6	30.8	5.4	18200	3475	0.83	82	Y	4x10	13	
		575	1.15	22.1	24.6	5.4	18200	3475	0.83	82	Y	4x10	13	
25	18,5	230	1.15	73.4	80	5.7	22200	3475	0.76	83		4x8	13	
		460	1.15	36.7	40	5.7	22200	3475	0.76	83	Y	4x8	13	
		575	1.15	29.3	32	5.7	22200	3475	0.76	83	Y	4x8	13	
30	22	230	1.15	95	105	5.5	26500	3480	0.7	83		4x8	13	
		460	1.15	44.7	49.8	5.8	26500	3480	0.74	83	Y	4x8	13	
		575	1.15	35.7	39.8	5.8	26500	3480	0.75	83	Y	4x8	13	
40	30	460	1.15	54	62	6.3	35700	3480	0.83	84	Y	4x8	13	
		575	1.15	43.2	49.6	6.3	35700	3480	0.83	84	Y	4x8	13	
50	37	460	1.15	69	77	6.1	44800	3480	0.82	83	Y	4x8	13	
		575	1.15	55	62	6.2	44800	3480	0.82	83	Y	4x8	13	
60	45	460	1.15	82	92	6.5	53500	3450	0.83	84	Y	4x8	13	

23. SINGLE PHASE MOTOR WINDING RESISTANCES

Table 13: TW4" 1 PHASE 2 WIRE MOTOR WINDING RESISTANCES

ELECTRICAL DATA 2 WIRE				
TW4" 2W SINGLE PHASE MOTORS				
P2		V [V]	WINDING RESISTANCE	
[hp]	[kW]			
0.5	0.37	115	0.95	
		230	3.7	
0.75	0.5	230	2.5	
1.0	0.75	230	1.9	
1.5	1.1	230	1.45	

Table 14: GG4" 1 PHASE 3 WIRE MOTOR WINDING RESISTANCES

ELECTRICAL DATA 3 WIRE				
GG4" 3W SINGLE PHASE MOTORS				
P2		V [V]	MAIN RESISTANCE	START RESISTANCE
[hp]	[kW]			
0.5	0.37	115	1.2	4.9
		230	3.9	15
0.75	0.5	230	3.0	10.8
1.0	0.75	230	2.4	9.9
1.5	1.1	230	1.8	9.1
2	1.5	230	1.9	5.7
3	2.2	230	1.2	2.5
5	3.0	230	0.8	1.5

Table 15: GF6" 1 PHASE MOTOR WINDING RESISTANCES

GF6" 3W SINGLE PHASE MOTORS				
7.5	5.0	0.5	1.4	1.4
10	7.5	0.4	1.0	1.0
15	11	0.2	0.6	0.6

23. GG4" THREE PHASE MOTOR WINDING RESISTANCES

Table 16: GG4" 3 PHASE MOTOR WINDING RESISTANCES

ELECTRICAL DATA 60 Hz			
GG4" THREE PHASE MOTORS			
P2		V	WINDING RESISTANCE
[hp]	[kW]	[V]	
0.5	0.37	230	5.8
		460	25.6
		575	39
0.75	0.5	230	3.9
		460	17.3
		575	26
1.0	0.75	230	2.4
		460	13
		575	19.7
1.5	1.1	230	2.2
		460	8.9
		575	14.6
2	1.5	230	1.5
		460	6
		575	9
3	2.2	230	1.3
		460	5.1
		575	7.7
5	3.0	230	0.83
		460	3.3
		575	5.2
7.5	5.0	230	0.6
		460	2.35
		575	3.7
10	7.5	460	2
		575	3.2

23. GF6” THREE PHASE MOTOR WINDING RESISTANCES

Table 17: GF6” 3 PHASE MOTOR WINDING RESISTANCES

ELECTRICAL DATA 60 Hz			
<i>THREE PHASE MOTORS</i>			
P2		V	WINDING RESISTANCE
[hp]	[kW]	[V]	
5,5	4	230	0.73
		460	3
		575	3.75
7,5	5,5	230	0.55
		460	2
		575	2.5
10	7,5	230	0.36
		460	1.6
		575	2
12,5	9,3	230	0.3
		460	1.27
		575	1.56
15	11	230	0.22
		460	0.95
		575	1.15
20	15	230	0.19
		460	0.7
		575	0.81
25	18,5	230	0.14
		460	0.58
		575	0.68
30	22	230	0.11
		460	0.5
		575	0.57
40	30	460	0.33
		575	0.38
50	37	460	0.26
		575	0.31
60	45	460	0.25
		575	0.30

24. MAXIMUM CABLE LENGTHS IN FT

Table 18: Single Phase 60Hz

Motor rating		Copper Wire Size												
Volts	Hp	14	12	10	8	6	4	2	0	00	000	0000	250	300
115	0.5	100	160	250	390	620	960	1460	2160	2630	3140	3770		
	0.5	400	650	1020	1610	2510	3880	5880	8720					
	0.75	300	480	760	1200	1870	2890	4370	6470	7870	9380			
	1.0	250	400	630	990	1540	2380	3610	5360	6520	7780	9350		
	1.5	190	310	480	770	1200	1870	2850	4280	5240	6300	7620		
	2.0	150	250	390	620	970	1530	2360	3620	4480	5470	6700		
	3.0	120	190	300	470	750	1190	1850	2890	3610	4470	5550		
	5.0			180	280	450	710	1110	1740	2170	2680			
	7.5				200	310	490	750	1140	1410	1720			
	10					250	390	600	930	1160	1430	1760		
15						270	430	660	820	1020	1260			

Three Phase 60Hz

Motor rating		Copper Wire Size												
Volts	Hp	14	12	10	8	6	4	2	0	00	000	0000	250	300
230	0.5	930	1490	2350	3700	5760	8910							
	0.75	670	1080	1700	2580	4190	6490	9860						
	1.0	560	910	1430	2260	3520	5460	8290						
	1.5	420	670	1060	1670	2610	4050	6160	9170					
	2	320	510	810	1280	2010	3130	4770	7170	8780				
	3	240	390	620	990	1540	2400	3660	5470	6690	8020	9680		
	5		230	370	590	920	1430	2190	3290	4030	4850	5870	6650	7560
	7.5			260	420	650	1020	1560	2340	2870	3440	4160	4710	5340
	10				310	490	760	1170	1760	2160	2610	3160	3590	4100
	15					330	520	800	1200	1470	1780	2150	2440	2780
	20						400	610	930	1140	1380	1680	1910	2180
	25						320	500	750	920	1120	1360	1540	1760
	30							410	620	760	930	1130	1280	1470
460	0.75	2730	4350	6850										
	1.0	2300	3670	5770	9070									
	1.5	1700	2710	4270	6730									
	2	1300	2070	3270	5150	8050								
	3	1000	1600	2520	3970	6200								
	5	590	950	1500	2360	3700	5750							
	7.5	420	680	1070	1690	2640	4100	6260						
	10	310	500	790	1250	1960	3050	4680	7050					
	15			540	850	1340	2090	3200	4810	5900	7110			
	20			410	650	1030	1610	2470	3730	4580	5530			
	25				530	830	1300	1990	3010	3700	4470	5430		
	30				430	680	1070	1640	2490	3060	3700	4500	5130	5860
	40						790	1210	1830	2250	2710	3290	3730	4250
50						640	980	1480	1810	2190	2650	3010	3420	
60							830	1250	1540	1850	2240	2540	2890	
575	1	3630	5800	9120										
	1.5	2620	4180	6580										
	2	2030	3250	5110	8060									
	3	1580	2530	3980	6270									
	5	920	1480	2330	3680	5750								
	7.5	660	1060	1680	2650	4150								
	10	490	780	1240	1950	3060	4770							
	15		530	850	1340	2090	3260							
	20			650	1030	1610	2520	3860	5830					
	25			520	830	1300	2030	3110	4710					
	30				680	1070	1670	2560	3880	4770	5780	7030	8000	
	40					790	1240	1900	2860	3510	4230	5140	5830	
	50						1000	1540	2310	2840	3420	4140	4700	5340
60						850	1300	1960	2400	2890	3500	3970	4520	

25. TIGHTENING MOTOR LEAD CONNECTOR SCREWS

- !** 4" Motors: 1.1 to 1.4 ft-lb. (1.5 to 1.9 N-m)
 6" Motors: 1.1 to 1.4 ft-lb. (1.5 to 1.9 N-m)

Screws tightening torques recommended for field assembly are shown. Rubber compression set within the first few hours after assembly may reduce the screws torque. This is a normal condition which does not indicate reduced seal effectiveness. Retightening is not required, but is permissible and recommended if original torque was questionable. A motor lead assembly should not be reused. A new lead assembly should be used whenever one is removed from the motor, because rubber set and possible damage from removal may prevent proper resealing of the old lead. All motors returned for warranty consideration must have the lead returned with the motor.


26. SHAFT HEIGHT

Table 19: MOTOR SHAFT HEIGHTS

Motor	Normal Shaft Height		Free End Play	
				Min
4"	1 1/2"	38.17mm	38.30 mm	0.010"
			38.05 mm	0.25 mm
6"	2.867"	72.88mm	73.02mm	0.014"
			72.65mm	0.37mm

21


27. 4CBUS CONTROL BOX DIMENSIONS Type CSIR

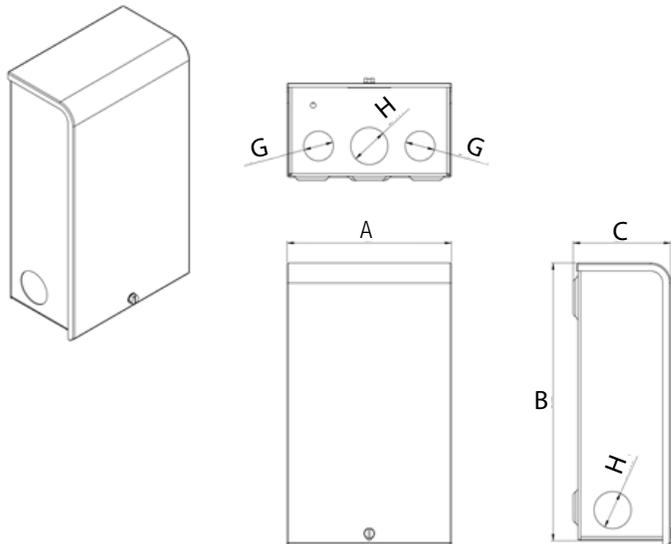

4CBUS BOX & KNOCKOUT DIMENSION		
Pos.	mm	inch
A	124	4.9"
B	214	8.2"
C	74	2.9"
G	PG 13.5	1/2" conduit
H	PG 21	3/4" conduit

Volts/Hz	Hp Motor	kW Motor	CB Model	Capacitor	
				µF	Volts
115/60	0.5	0.37	4CBUS 0.5HP 115v60Hz Basic TESLA	250-300	125
230/60	0.5	0.37	4CBUS 0.5HP 230v60Hz Basic TESLA	59-71	250
	0.75	0.55	4CBUS 0.75HP 230v60Hz Basic TESLA	86-103	250
	1	0.75	4CBUS 1.0HP 230v60Hz Basic TESLA	105-126	250

28. 4CBUS CONTROL BOX DIMENSIONS Type CSCR

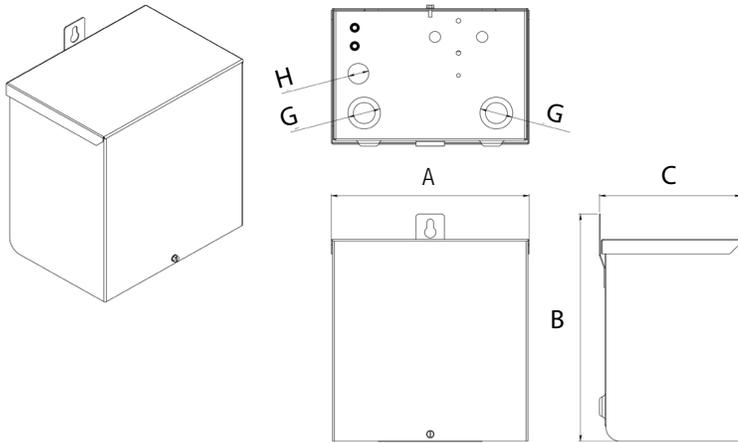


4CBUS BOX & KNOCKOUT DIMENSION		
Pos.	mm	inch
A	210	8.3"
B	249	9.8"
C	150	5.9"
G	34	1" Conduit
H	23	1/2" Conduit

22

Volts/Hz	Hp Motor	kW Motor	CB Model	Run Cap		Start Cap	
				μF	Volts	μF	Volts
230/ 60	1.5	1.1	4CBUS 1.5HP 230 Basic	10	370	105-126	250
	1.5	1.1	4CBUS 1.5HP 230 Plus	10	370	105-126	250
	2	1.5	4CBUS 2.0HP 230 Basic	20	370	105-126	250
	2	1.5	4CBUS 2.0HP 230 Plus	20	370	105-126	250
	3	2.2	4CBUS 3.0HP 230 Basic	45	370	208-250	250
	3	2.2	4CBUS 3.0HP 230 Plus	45	370	208-250	250
	5	3.7	4CBUS 5.0HP 230 Basic	80	370	270-324	250
	5	3.7	4CBUS 5.0HP 230 Plus	80	370	270-324	250

28. 6CBUS CONTROL DIMENSIONS BOX Type CSCR

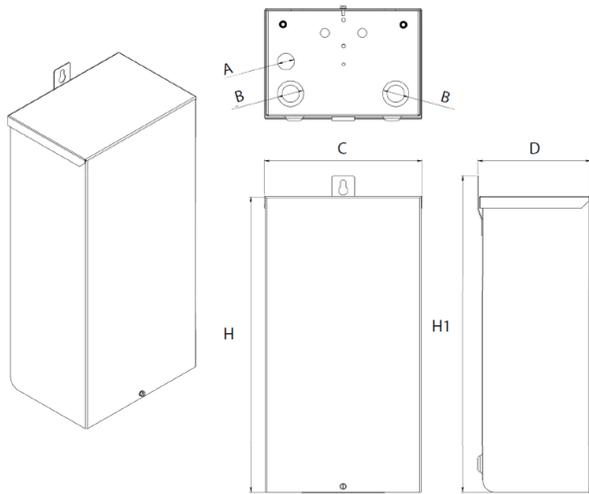

6CBUS BOX & KNOCKOUT DIMENSION		
Pos.	mm	inch
A	23	1/2" Conduit
B	34	1" Conduit
C	210	8.268"
D	160	6.299"
H	392	15.433"
H1	420	16.535"

Volts/Hz	Hp Motor	kW Motor	CB Model	Run Cap		Start Caps.	
				µF	Volts	µF	Volts
230/ 60	7.5	5.0	6CBUS 7.5HP 230V60Hz PLUS	45	370	270-324	330
						216-260	330
	10	7.5	6CBUS 10 HP 230V60Hz PLUS	35	370	270-324	330
				35	370	216-260	330
	15	11	6CBUS 15 HP 230V60Hz PLUS			130-156	330
				45	370	270-324	330
				45	370	270-324	330
				45	370	161-193	330

29. 4CBUS - CONTROL BOX - WIRING DIAGRAMS – CSIR SERIES



TO PREVENT HAZARD OF FATAL OR SERIOUS ELECTRIC SHOCK :

Connect this control enclosure, all metal plumbing, and the motor frame to the power supply grounding terminal using copper wire complying with electrical codes. A ground wire at least the size of power wires complies. Smaller wire may comply under some conditions.

Permanently close all unused wiring opening in this and other equipment.

Switch off power to this circuit at the power supply panel (not in this control) before working on or around the control, pipes, cable, pump or motor.

29. 4CBUS - CONTROL BOX - WIRING DIAGRAMS – CSIR SERIES

INSTALLATION AND OPERATION:

Mounting – Be sure that the control box is mounted in a vertical position with the top side up. If it is mounted in any other position, the starting relay may not function and the overload may trip.

Connections – The control box should be wired to the line and the motors as shown in the diagram. The pump will not operate without this control box.

Operation without the control box will burn out the motor. Installation of this motor and control must include circuit and component protection in compliance with U.S. National Electrical Code or Canadian Electrical Code, Part.1


Protection – Trip of overload indicates a shorted capacitor, voltage problems, an overloaded or locked pump, or the start relay should be replaced. Reset and analyse for tripping cause.

Do not remove or short out overload protection, since doing so is likely to cause motor burnout.

Use 75° C copper wires/conductors only, 14-10 AWG, tightening torque 20lbs*inch.

For guarantee the Enclosure Type 3R need fix the box using 2 fixing holes.

0.5 – 0.75 1HP 60HZ 115/230 V

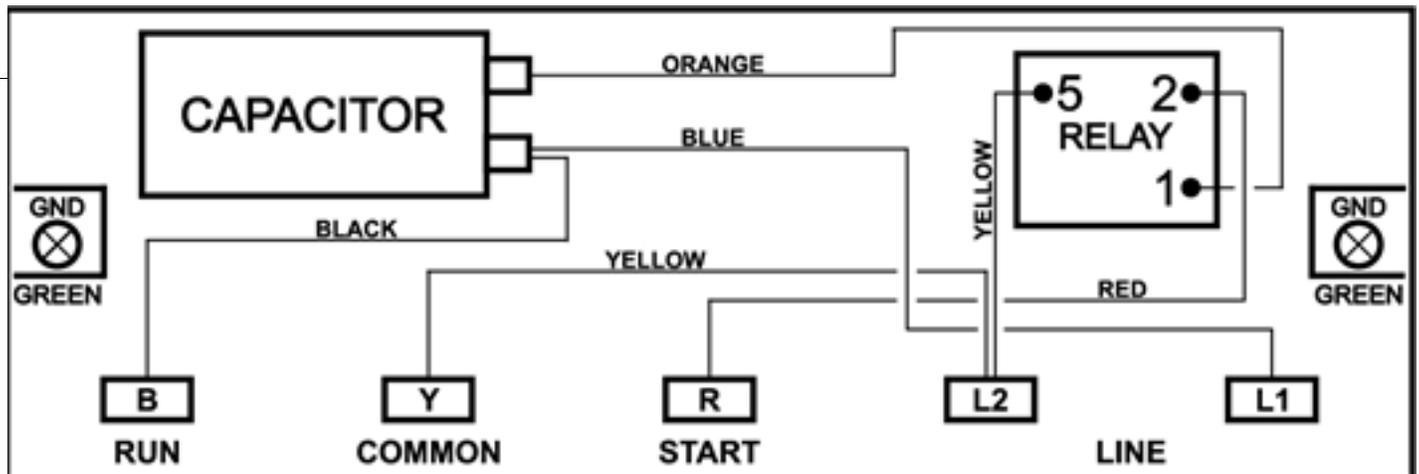

How to check the color code of a drop cable (Single-Phase 3-Wire Units)

With an ohmmeter measure:

Cable 1 to Cable 2,

Cable 2 to Cable 3,

Cable 3 to Cable 1

Find the highest resistance reading.

The lead not used in the highest reading is the yellow lead.

Use the yellow lead and each of the other two leads to get two readings:

Highest is the red lead.

Lowest is the black lead.

EXAMPLE:

The ohmmeter readings were:

Cable 1 to Cable 2 - 6 ohms

Cable 2 to Cable 3 - 2 ohms

Cable 3 to Cable 1 - 4 ohms

The lead not used in the highest reading (6 ohms) was Cable 3 so

Cable 3 = **Yellow**

From the yellow lead, the highest reading (4 ohms) was To Cable 1 so

Cable 1 = **Red**

From the yellow lead, the lowest reading (2 ohms) was To Cable 2 so

Cable 2 = **Black**

30. 4CBUS - CONTROL BOX - WIRING DIAGRAMS – CSCR SERIES



TO PREVENT HAZARD OF FATAL OR SERIOUS ELECTRIC SHOCK :

Connect this control enclosure, all metal plumbing, and the motor frame to the power supply grounding terminal using copper wire complying with electrical codes. A ground wire at least the size of power wires complies. Smaller wire may comply under some conditions

Permanently close all unused wiring opening in this and other equipment.

Switch off power to this circuit at the power supply panel (not in this control) before working on or around the control, pipes, cable, pump or motor.

INSTALLATION AND OPERATION:

Mounting – Be sure that the control box is mounted in a vertical position with the top side up. If it is mounted in any other position, the starting relay may not function and the overload may trip.

Connections – The control box should be wired to the line and the motors as shown in the diagram.

The pump will not operate without this control box.

Operation without the control box will burn out the motor. Installation of this motor and control must include circuit and component protection in compliance with U.S. National Electrical Code or Canadian Electrical Code, Part.1

Protection – Trip of overload indicates a shorted capacitor, voltage problems, an overloaded or locked pump, or the start relay should be replaced. Reset and analyse for tripping cause.

Do not remove or short out overload protection, since doing so is likely to cause motor burnout.

Use 75° C copper wires/conductors only, 14-10 AWG, tightening torque 20lbs*inch.

25


For guarantee the Enclosure Type 3R need fix the box using 2 fixing holes.

CHECKING PROCEDURE: BE SURE POWER IS TURNED OFF:


- A) **OVERLOAD (Push reset button to make sure contacts are closed)**
 1. Ohmmeter setting: (Rx1).
 2. Terminal connections: ohmmeter leads to overload terminals.
 3. Ohmmeter reading: should not be over 0.5 ohms.
- B) **CAPACITOR (Disconnect one lead from each capacitor prior to checking)**
 1. Ohmmeter setting: (Rx1000).
 2. Terminal connections: individual capacitor terminals.
 3. Ohmmeter reading: pointer should swing toward zero then drift back toward infinity.
- C) **RELAY COIL (Disconnect lead from terminal 5)**
 1. Ohmmeter setting: (Rx1000).
 2. Terminal connections: “5” and “2” on relay.
 3. Ohmmeter reading: 4500-7000 ohms
- D) **RELAY CONTACT (Disconnect lead from terminal 1)**
 1. Ohmmeter setting: (Rx1).
 2. Terminal connections: “1” and “2” on relay.
 3. Ohmmeter reading: should be zero.
- E) **MAGNETIC CONTACTOR ONLY (Disconnect 1 coil lead)**
 1. Ohmmeter setting: (Rx100).
 2. Check coil resistance: 1000-1400 ohms.
 3. Remove contact cover and inspect contacts

30. 4CBUS - CONTROL BOX - WIRING DIAGRAMS – CSCR SERIES

1.5 HP 230V 60Hz PLUS

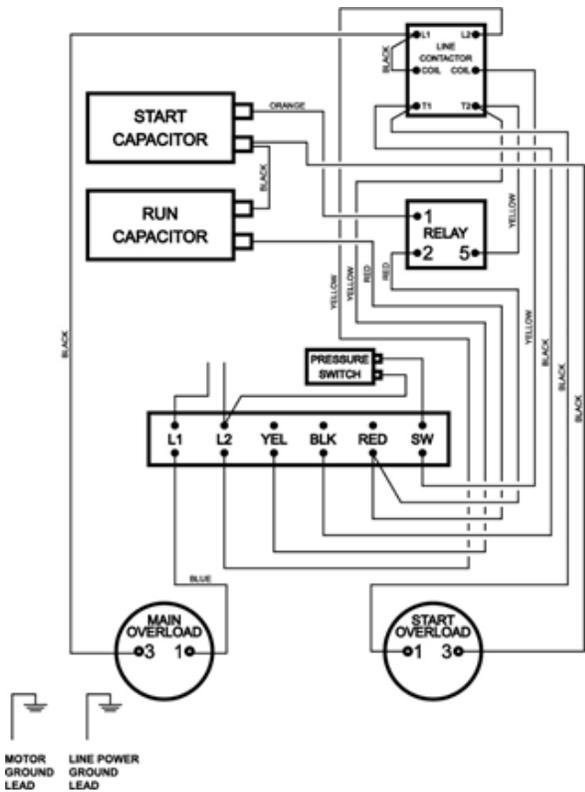


1.5 HP 230V 60Hz BASIC

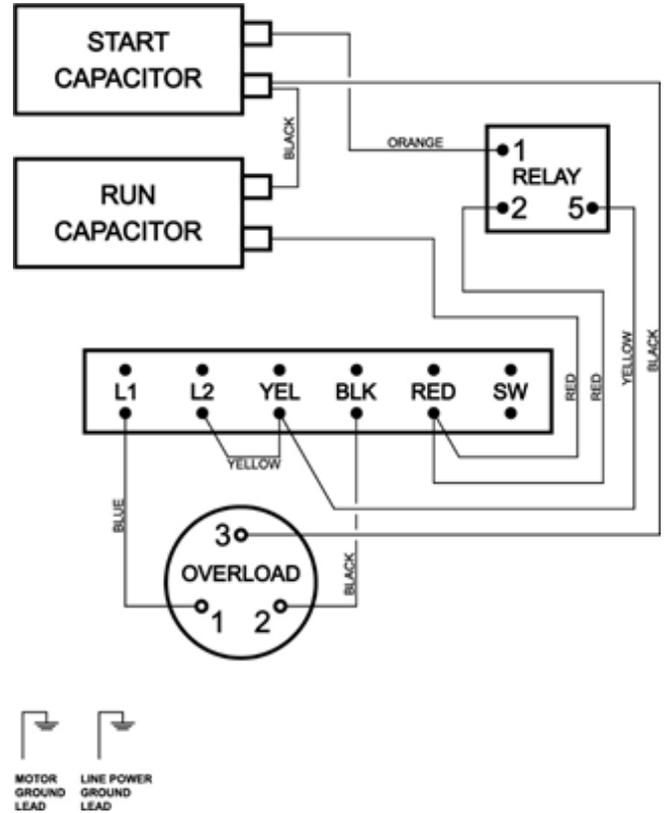


26


2 HP 230V 60Hz PLUS

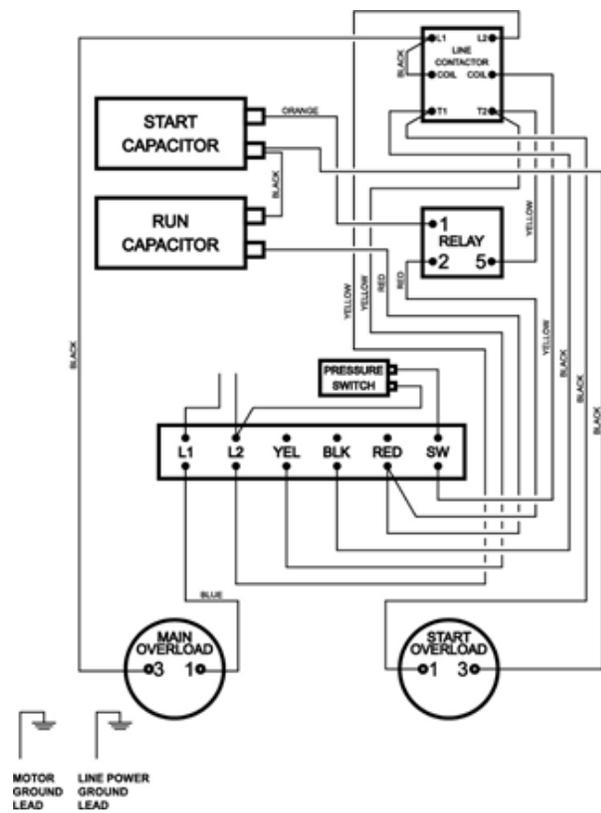

2 HP 230V 60Hz BASIC

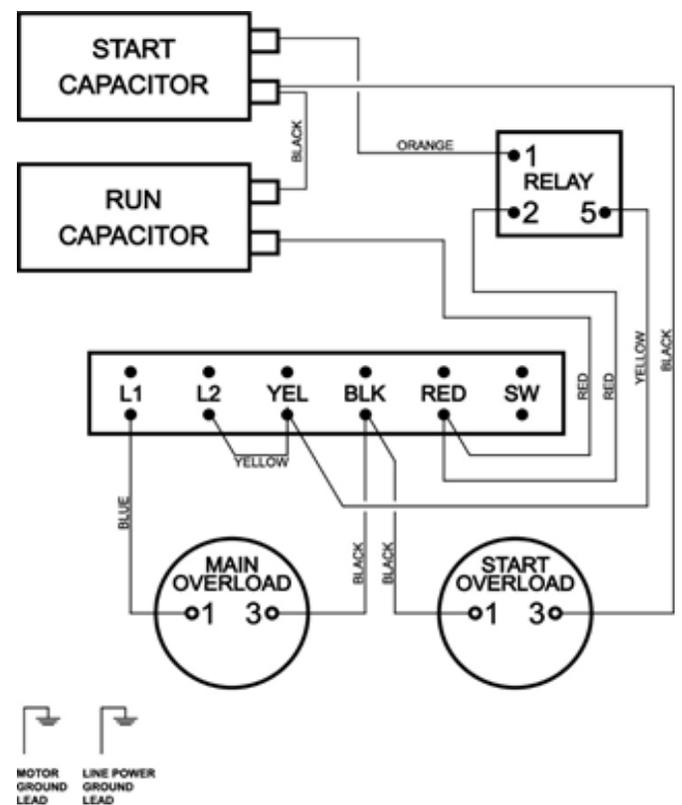


30. 4CBUS - CONTROL BOX - WIRING DIAGRAMS – CSCR SERIES

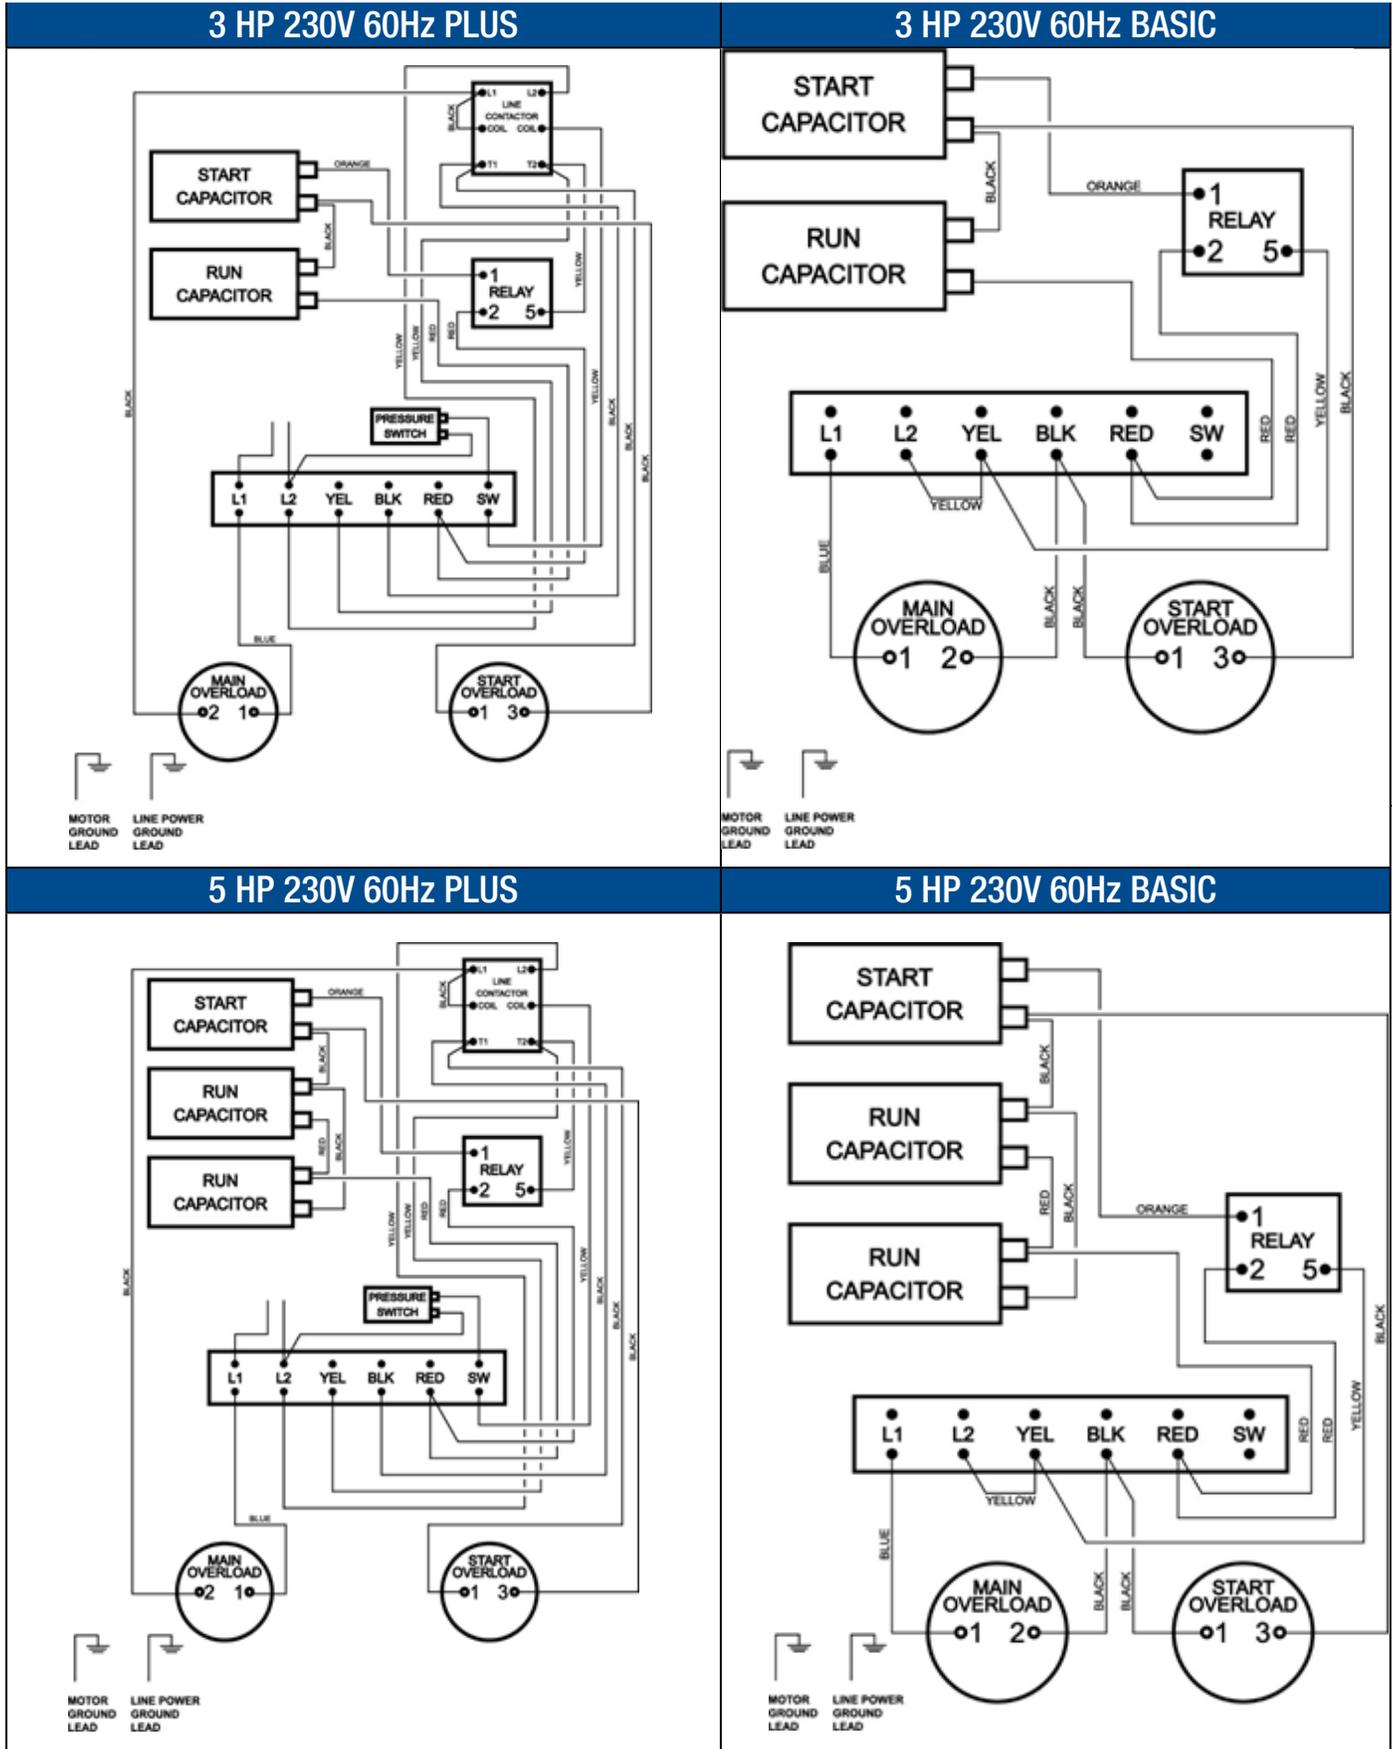


30. 6CBUS - CONTROL BOX - WIRING DIAGRAMS – CSCR SERIES

7.5 HP 230V 60Hz PLUS

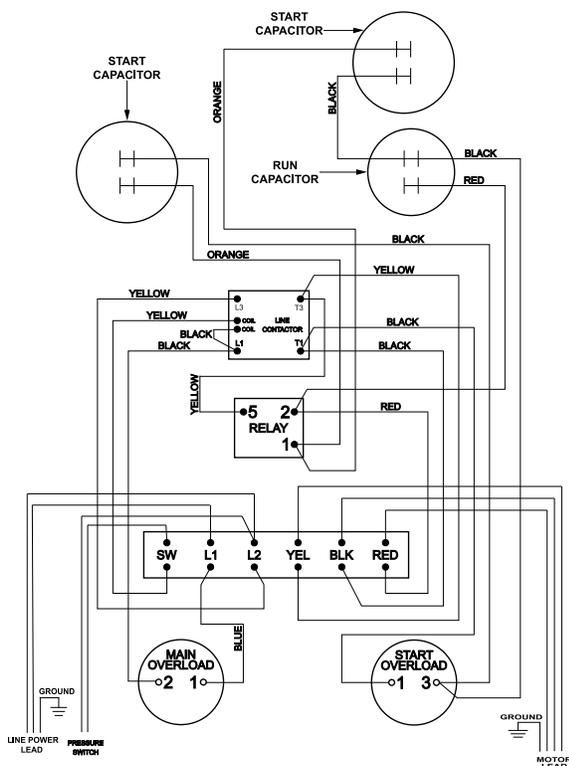


if you are not using a control switch such as a pressure switch you will need to connect a wire between the SW & L2 terminals for the panel to work.

10HP 230V 60Hz PLUS

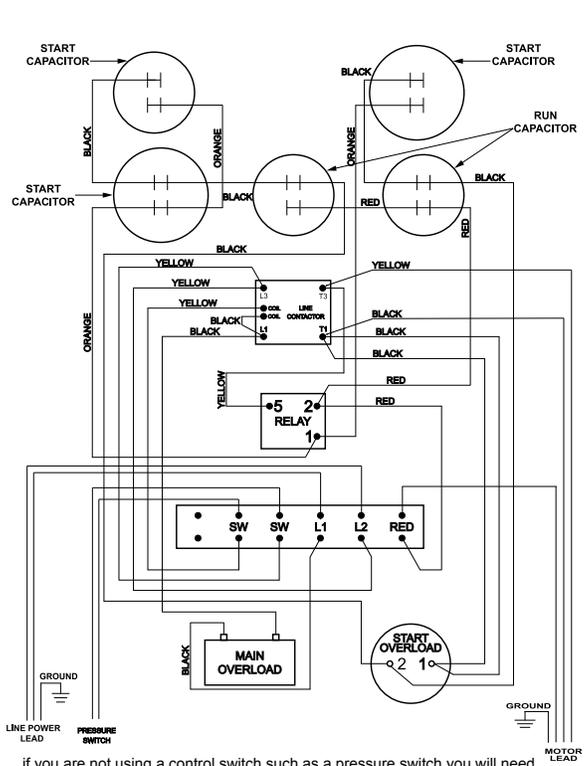

if you are not using a control switch such as a pressure switch you will need to connect a wire between the SW terminals for the panel to work.

15 HP 230V 60Hz PLUS

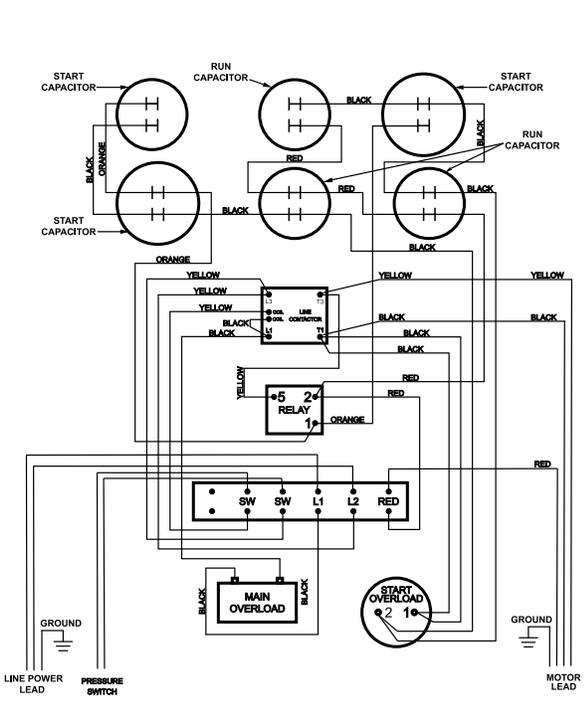


if you are not using a control switch such as a pressure switch you will need to connect a wire between the SW terminals for the panel to work.

31. THREE PHASE POWER UNBALANCE


A full three phase supply is recommended for all three phase motors, consisting of three individual transformers or one three phase transformer. So-called “open” delta or wye connections using only two transformers can be used, but are more likely to cause problems, such as poor performance overload tripping or early motor failure due to current unbalance.

Transformer ratings should be no smaller than listed on Transformer Size Chart on the next page.

OPEN DELTA OR WYE

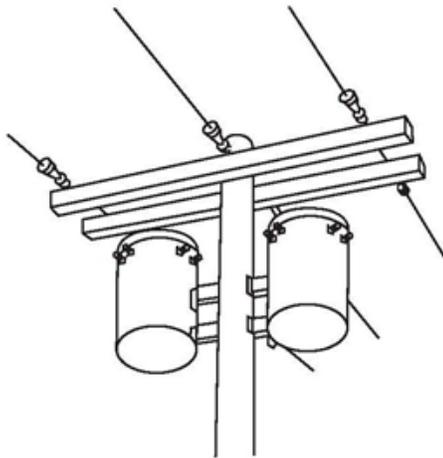

FULL THREE PHASE

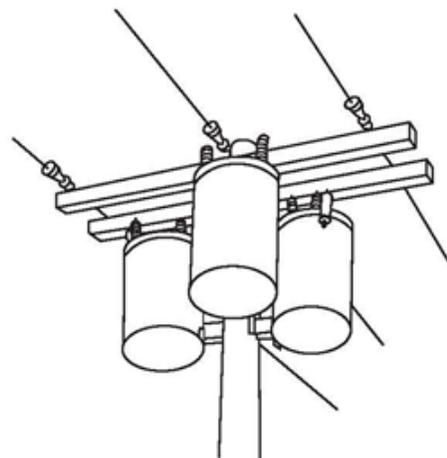

Checking and correcting rotation and current unbalance.

1. Establish correct motor rotation by running in both directions. Change rotation by exchanging any two of the three motor leads. The rotation that gives the most water flow is always the correct rotation.
2. After correct rotation has been established, check the current in each of the three motor leads and calculate the current unbalance as explained in 3 below. If the current unbalance is 2% or less, leave the leads as connected. If the current unbalance is more than 2%, current readings should be checked on each leg using each of the three possible hook-ups. Roll the motor leads across the starter in the same direction to prevent motor reversal.
3. To calculate percent of current unbalance:
 - A. Add the three line amps values together
 - B. Divide the sum by three, yielding average current
 - C. Pick the amp value which is furthest from the average current (either high or low)
 - D. Determine the difference between this amp value (furthest from average) and the average
 - E. Divide the difference by the average. Multiply the result by 100 to determine percent of unbalance
4. Current unbalance should not exceed 5% at service factor load or 10% at rated input load. If the unbalance cannot be corrected by rolling leads, the source of the unbalance must be located and corrected. If, on the three possible hookups, the leg farthest from the average stays on the same power lead, most of the unbalance is coming from the power source. However, if the reading farthest from average moves with the same motor lead, the primary source of unbalance is on the “motor side” of the starter. In this instance, consider a damaged cable, leaking splice, poor connection, or faulty motor winding


31. THREE PHASE POWER UNBALANCE

Phase designation of leads for CCW rotation viewing shaft end.

To reverse rotation, interchange any two leads

- Phase 1 or "A" – Black Motor Lead or T1
- Phase 2 or "B" – Yellow Motor Lead or T2
- Phase 3 or "C" – Red Motor Lead or T3

Notice: Phase 1, 2 and 3 may not be L1, L2 and L3.

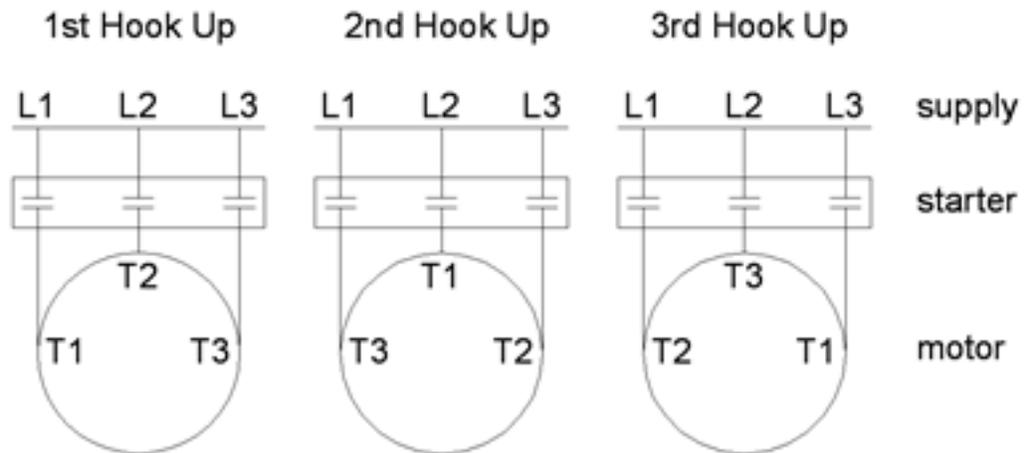

Example:

T1 = 51 amps +
 T2 = 46 amps +
 T3 = 53 amps =
 Total = 150 amps

T1 = 50 amps +
 T2 = 49 amps +
 T3 = 51 amps =
 Total = 150 amps

T1 = 50 amps +
 T2 = 48 amps +
 T3 = 52 amps =
 Total = 150 amps

$150/3 = 50$ amps
 $50-46 = 4$ amps
 $4/50 = 0.08$ or 8%

$150/3 = 50$ amps
 $50-49 = 1$ amp
 $1/50 = 0.02$ or 2%

$150/3 = 50$ amps
 $50-48 = 2$ amps
 $2/50 = 0.04$ or 4%

32. TRANSFORMER SIZES

A full three phase supply is recommended for all three phase motors, consisting of three phase individual transformers or one three phase transformer.

"Open" delta or wye connections using only two transformers can be used, but are more likely to cause problems from current unbalance.

Transformer ratings should be no smaller than listed in the table for supply power to the motor alone.

32. TRANSFORMER SIZES



A full three phase supply is recommended for all three phase motors, consisting of three phase individual transformers or one three phase transformer.

“Open” delta or wye connections using only two transformers can be used, but are more likely to cause problems from current unbalance.

Transformer ratings should be no smaller than listed in the table for supply power to the motor alone.

Table 20: TRANSFORMER SIZING

HP	kW	Required kVa	KVA Rating (smallest) For Each Transformer	
			Open WYE or D 2 Transformers	Closed WYE or D 3 Transformers
1.5	1.1	3.0	2.0	1.0
2	1.5	4.0	2.0	1.5
3	2.2	5.0	3.0	2.0
5	3.7	7.5	5.0	3.0
7.5	5.5	10	7.5	5.0
10	7.5	15	10.0	5.0

31

33. POWER SUPPLY BY A GENERATOR



Attention: the applicable tolerances from main supply must also be applied by power supply via generators. When operating a motor via a generator please bear in mind that the starting current of the motor is five times the nominal motor current and that mean power factor of 0.6 for starting can be expected. Also make sure that a sufficient generator power is permanently available and that for starting the voltage must be at least 65% of the nominal motor Name plate voltage.

Table 21: GENERATOR SIZING

MOTOR POWER		GENERATOR POWER	
kW	Hp	kW	Hp
4.0	5.5	10	12.5
5.5	7.5	12.5	15.6
7.5	10	15	18.8
11	15	22.5	28
15	20	30	38
18.5	25	40	50
22	30	45	57
30	40	60	75
37	50	75	100
45	60	100	145

34. INSULATION TESTING

For the necessary inspections and insulation testing one tool is required:
 Insulation measuring tester (Megaohmmeter) unit 500v test, display up to min 200 M Ohm .

The correct execution of the junction (hermetic sealing) can be verified testing it under water for at least 15 min and measuring with the Megaohmmeter the insulation resistance between the metal recipient, filled with water (or water itself) and each of the phase wires of the cable connected to the motor.
 For a new motor the correct measurement has to be at least 200 M Ohm.

Another measure has to be done before installing the motor / pump in the place of use:

1	connect a measuring cable to the ground lead
2	connect the other measuring cable to each conductor of the connected motor cable.

The exact values have to be at least **200 M Ohm** for a new motor, and **20 M Ohm** with a used motor installed.
 It is always suggested to repeat this operation various times while lowering the motor/pump in the well.

35. RESISTANCE OF THE DROP CABLE

The values below are for copper conductors. If aluminum conductor drop cable is used, the resistance will be higher.
 To determine the actual resistance of the aluminum drop cable, divide the ohm readings from this chart by 0.61.
 This chart shows total resistance of cable from control to motor and back.

Resistance in ohms per 100 ft of Wire @ 50 °F

Table 22: DROP CABLE RESISTANCE

AWG WIRE SIZE (COPPER)	Resistance Ohms	MCM WIRE SIZE (COPPER)	Resistance Ohms
14	0.544	250	0.0088
12	0.338	300	0.0073
10	0.214	350	0.0063
8	0.135	400	0.0056
6	0.082	500	0.0044
4	0.052	600	0.0037
2	0.032	700	0.0032
0	0.021		
00	0.017		
000	0.013		
0000	0.010		

When measured through the drop cable, the resistance of the drop cable must be subtracted from the ohmmeter readings to get the winding resistance of the motor

36. BOLT TORQUE SETTINGS

Table 23: TORQUE SETTING

Bolt Size	Torque Setting in Nm (ft-lb)	
	Steel 8.8	Stainless Steel 304-316/904
M6	9 (6.638)	7 (5.163)
	Steel 8.8	Stainless Steel 304-316/904
M8	23 (16.964)	17 (12.539)
	Steel 8.8	Stainless Steel 304-316/904
M10	45 (33.190)	33 (24.340)
	Steel 8.8	Stainless Steel 304-316/904
M12	83 (61.218)	74 (54.580)
	Steel 8.8	Stainless Steel 304-316/904
M14	132 (97.3580)	119 (87.770)
	Steel 8.8	Stainless Steel 304-316/904
M16	200 (147.51)	183 (134.97)
	Steel 8.8	Stainless Steel 304-316/904
M18	275 (202.83)	260 (191.77)
	Steel 8.8	Stainless Steel 304-316/904
M20	390 (287.65)	370 (272.90)
	Steel 8.8	Stainless Steel 304-316/904

37. MOTOR WARRANTY FORM

DISTRIBUTOR INFORMATION			
NAME OF DISTRIBUTOR			
DISTRIBUTOR RGA/ WARRANTY #			
NAME OF INSTALLER			
NAME OF END USER			
DATE SUBMITTED			
MOTOR INFORMATION			
MOTOR DESCRIPTION			
PART NUMBER			
SERIAL NUMBER			
PROD. DATE CODE			
DATE OF INSTALLATION			
# OF STARTS PER DAY			
POWER AND CABLING			
POWER CABLE LENGTH			
POWER CABLE SIZE (DIAMETER/GAUGE)			
INCOMING VOLTAGE	L1	L2	L3
RUNNING AMPS	L1	L2	L3
POWER TYPE	GRID:	GENERATOR:	KVA of GEN
CONTROL PANEL			
CONTROL PANEL MANUFACTURER AND MODEL			
DOL OR VFD			
(DOL) AMPERAGE SETTING			
(DOL) PHASE PROTECTION?	YES:	NO:	
(VFD) MAX AMPERAGE			
(VFD) MAX Hz			
(VFD) MIN Hz			
(VFD) RAMP TIME TO 30Hz			

37. MOTOR WARRANTY FORM

PUMP INFORMATION	
MANUFACTURER	
MODEL	
STAGES	
2-POLE/4-POLE?	2-POLE: _____ 4-POLE: _____
DESIGN RATING	GPM: _____ TDH: _____ RPM: _____
HORSEPOWER REQUIRED BY DESIGN	
SET DEPTH	
STATIC WATER LEVEL	
MOTOR INFORMATION	

